



TECHNICAL BULLETIN

No: LA-501-001

Issue: 1

Date: 07 Mar 05

CIRCULATE: TO

Service Mgr
X

Warranty
X

Workshop
X

Body Shop
X

Parts
X

SECTION: LA501-05

Door Casing Protective Material Removal

AFFECTED VEHICLE RANGE:

Land Rover LR3 (LA)

VIN: 5A000360 to 5A314027

CONDITION SUMMARY:

CORRECT REMOVAL PROCESS REQUIRED

Incorrect removal of door casing protection during Vehicle Preparation (PDI) may lead to customer concerns of a rattle from any of the four side doors door casing or a water leak. The protection can tear if not correctly removed. The material trapped between the door casing clips and the door gasket/seal can flutter to give a rattle and it also can create a water leak-path. Follow the process outlined in the Repair Procedure to ensure correct removal without leaving protective material tab remnants.

PARTS:

No Parts

WARRANTY:

Information Only

Normal warranty policy and procedures apply.

Material allowance is included in labor operation.

REPAIR PROCEDURE

PROPERLY REMOVE PROTECTIVE MATERIAL

⚠ CAUTION: To avoid noise or water ingress, adherence to correct removal procedures for protective door covers is required. It is important that tab pieces are not left behind when the protection is removed.

1. Remove the front door protective cover as follows:
 - Locate the four taps on the front door protective covers. (Figure 1)
 - Carefully release each door casing cover tab from the tab clips before removing the protective cover. (Figure 3)
 - Remove the protective cover.
2. Remove the rear door protective cover as follows:
 - Locate the four taps on the rear door protective covers. (Figure 2)
 - Carefully release each door casing cover tab from the tab clips before removing the protective cover. (Figure 3)
 - Remove the protective cover.

Figure 1

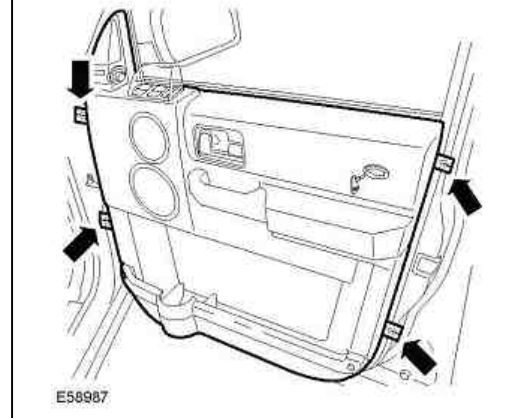


Figure 2

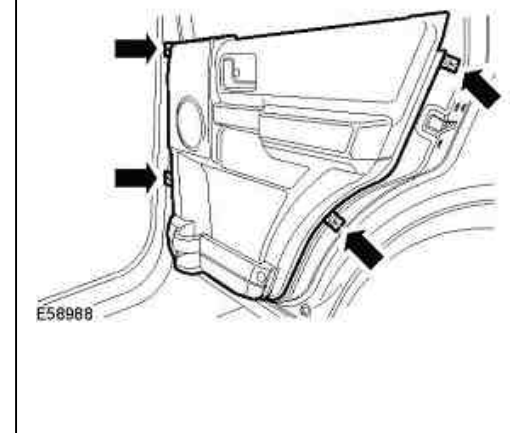


Figure 3

