

NO.2 MIL ILLUMINATES [ZJ, Z6]

B3E010318881W35

2	MIL ILLUMITATES
DESCRIPTION	The MIL is illuminated incorrectly.
POSSIBLE CAUSE	<ul style="list-style-type: none"> • The PCM illuminates for emission-related concern (DTC is stored in the PCM). • Instrument cluster malfunction <p>Note</p> <ul style="list-style-type: none"> • If the MIL blinks at steady rate, misfire condition could exist.

Diagnostic procedure

STEP	INSPECTION	RESULTS	ACTION
1	Connect WDS or equivalent to DLC-2. Retrieve any DTC. Are there any DTCs displayed?	Yes	DTC is displayed: <ul style="list-style-type: none"> • Go to the appropriate DTC inspection. (See DTC TABLE [ZJ, Z6].)
		No	No DTC is displayed: <ul style="list-style-type: none"> • Inspect the instrument cluster operation. (See INSTRUMENT CLUSTER INSPECTION.)
2	Verify test results. <ul style="list-style-type: none"> • If normal, return to diagnostic index to service any additional symptoms. (See ENGINE SYMPTOM TROUBLESHOOTING [ZJ, Z6].) • If malfunction remains, inspect related Service information perform repair or diagnosis. <ul style="list-style-type: none"> - If vehicle repaired, troubleshooting completed. - If vehicle not repaired or additional diagnostic information not available, replace the PCM. (See INTAKE-AIR SYSTEM REMOVAL/INSTALLATION [ZJ, Z6].) 		