

DTC C2785 [DSC]

B3E040243000W30

DTC	C2785	Combined sensor system (unperformed initialization procedure)
DETECTION CONDITION	• DSC detects that the initialization procedure for combined sensor has not been performed.	
POSSIBLE CAUSE	<ul style="list-style-type: none"> Initialization procedure for the combined sensor not performed Combined sensor malfunction 	

Diagnostic procedure

STEP	INSPECTION		ACTION
1	VERIFY OTHER DTC HAS BEEN RECORDED • Has DTC B2141 also been stored?	Yes	Go to the applicable DTC inspection. (See DTC Table .)
		No	Go to the next step.
2	VERIFY INITIALIZATION PROCEDURE • Was the combined sensor initialization procedure performed?	Yes	Go to the next step.
		No	Perform the combined sensor initialization procedure, then go to the next step. (See COMBINED SENSOR INITIALIZATION PROCEDURE .)
3	VERIFY THAT THE SAME DTC IS NOT PRESENT • Clear the DTCs from the memory. (See Clearing DTCs Procedures .) • Are the same DTCs present?	Yes	Repeat the inspection from Step 1. If the malfunction recurs, replace the DSC HU/CM, then go to the next step. (See DSC HU/CM REMOVAL/INSTALLATION .)
		No	Go to the next step.
4	VERIFY THAT NO OTHER DTCS ARE PRESENT • Are any other DTCs output?	Yes	Go to the applicable DTC inspection. (See DTC Table .)
		No	DTC troubleshooting completed.