

E.F.I. COMPUTER RELAY (3SZ-VE)

INSPECTION

1. EFI COMPUTER RELAY

- (a) Check for continuity.
- (1) Using the electrical tester check the continuity between the terminals of the connector.


Standard

Terminals	Continuity
1↔2	Continuity
3↔5	No continuity

- (2) Using a tester, make sure that there is continuity between terminals 3 and 5 when battery voltage is applied between terminals 1 and 2.

Standard:

Continuity

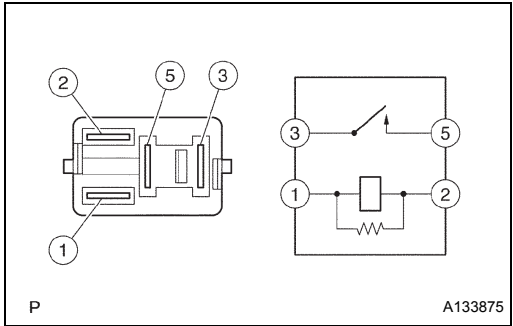

ES

