


DRIVE BELT INSPECTION [ZJ, Z6]

B3E011015800W02

Note

- Drive belt deflection/tension inspection is not necessary because of the use of the drive belt auto tensioner.

1. Remove the under cover and splash shield (RH).
2. Verify that the drive belt auto tensioner indicator mark does not exceed the limit.

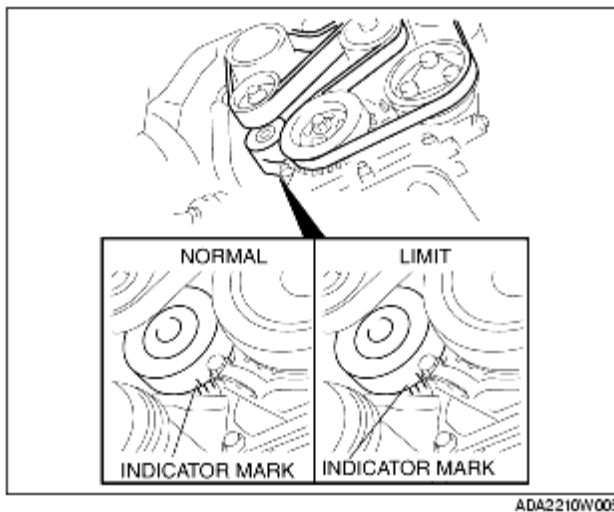

- If it exceeds the limit, replace the drive belt. (See [DRIVE BELT REPLACEMENT \[ZJ, Z6\]](#).)

3. Install the under cover and splash shield (RH).