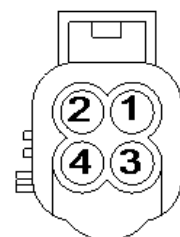
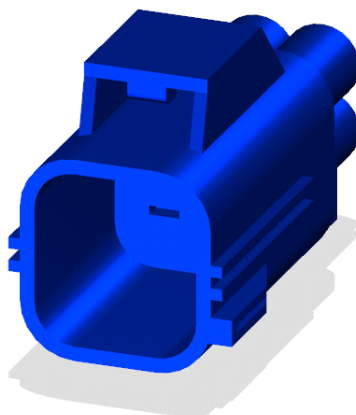
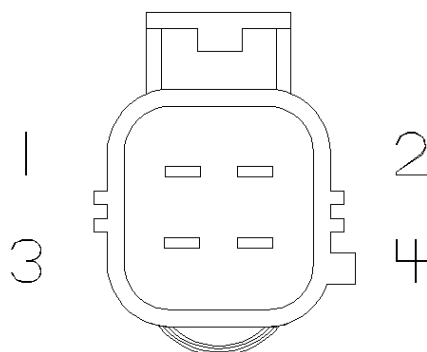
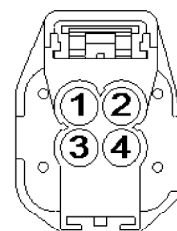
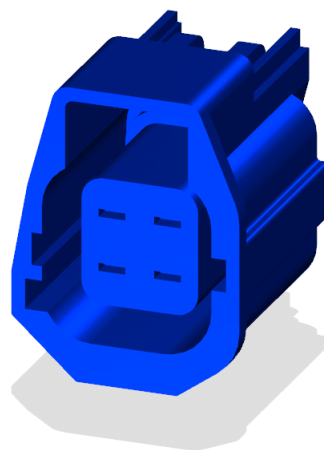
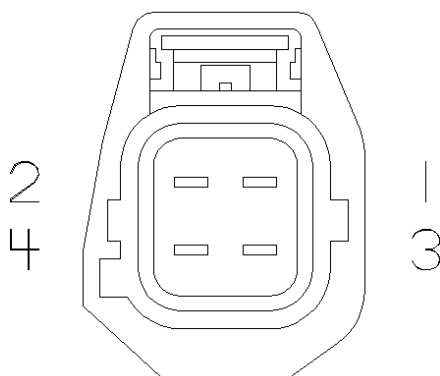


XY101A

**Connector No:** XY101A**Option:****Connector Details**

Color	DARK GRAY	
Part Number	Chassis_RT (Standard)	7283-5570-10
	FRONT BUMPER	7282-5570-10
Repair Kit Part Number	(Standard)	Terminal Kits Only
Part Description	Chassis_RT (Standard)	2.8 YESC CONNECTOR SUB ASSEMBLY W/O CPA
	FRONT BUMPER	2.8 YESC SEALED MALE SUB ASSEMBLY
Cavity Count	4	
Location View	<a href="#">Chassis_RT</a> (Standard)	
	<a href="#">FRONT BUMPER</a>	

**Connector Views****FRONT BUMPER****Mating Side:****Isometric View:****Wire Insertion Side:****Chassis\_RT****Isometric View:****Mating Side:****Wire Insertion Side:**

**NOTE:** When connector cavities are identified as "NO CONNECT" in the following table, there may be "Dummy (blunt cut) wires" or Cavities may be "Open", "Plugged, or "Flashed over" depending on vehicle option content.

Pin	Harness Family	Circuit	Circuit Functions	Color	Gauge/Size	Option
1	All Variants	L90	RIGHT FRONT FOG LAMP CONTROL	WH / OG	0.75	
2	All Variants	L89	LEFT FRONT FOG LAMP CONTROL	WH / YE	0.75	
3	All Variants	Z906	GROUND	BK	1.0	
4	All Variants	NO	NO CONNECT	NA	0	