


POWER MOS FET INSPECTION

B3E074000116W02

1. Verify that the continuity between the power MOS FET terminals is as indicated in the table.

- If there is any malfunction, replace the power MOS FET.
- If the blower motor operation is not normal even though no malfunction can be verified, inspect the climate control unit. (See [CLIMATE CONTROL UNIT INSPECTION \[FULL-AUTO AIR CONDITIONER\]](#).)

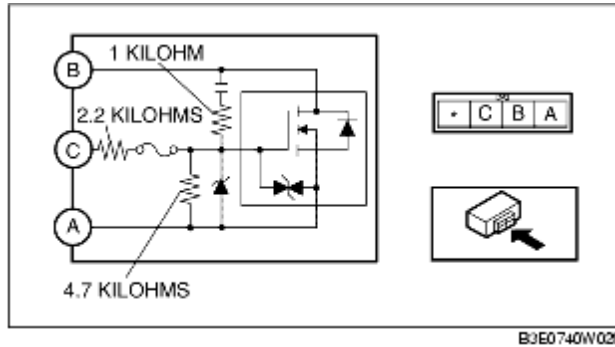

Tester lead		Resistance (kilohm)
+	-	
A	B	∞
A	C	6.9
B	A	Continuity detected
B	C	Continuity detected
C	A	6.9
C	B	∞