



## INSPECTION

### 1. VEHICLES NOT INVOLVED IN COLLISION

- (a) Do a diagnostic system check. (See page [DI-459](#))
- (b) Do a visual check which includes the following item with the side airbag assembly installed in the vehicle.

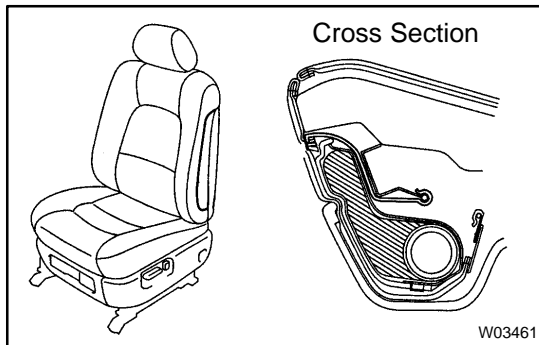

Check that there are no cuts or the frayed on seams and out side of seatback cover.

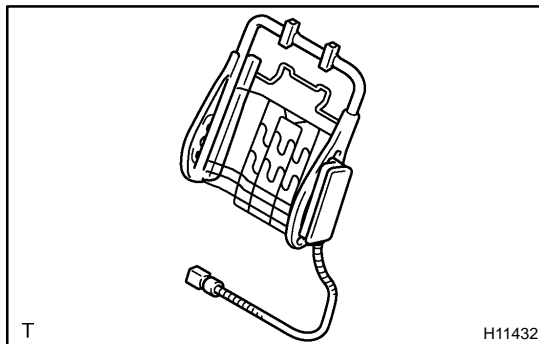

### 2. VEHICLE INVOLVED IN A COLLISION AND AIRBAG IS NOT DEPLOYED

- (a) Do a diagnostic system check. (See page [DI-459](#))
- (b) Do a visual check which includes the following items with the side airbag assembly removed from the vehicle.
  - Check cuts and cracks, or marked discoloration of the side airbag assembly.
  - Check cuts and cracks in wire harnesses, and chipping in connectors.

### 3. VEHICLE INVOLVED IN A COLLISION AND AIRBAG IS DEPLOYED

Do a visual check which includes the following items with the side airbag assembly removed from the vehicle.

- Check the side airbag installation part of the seat frame.
- Check the damage to the connector and wire harness.

#### HINT:

If the seat frame is deformed, never repair it. Always replace it with new one.

#### CAUTION:

For removal and installation of the side airbag assembly, see page [RS-42](#) and [RS-51](#). Be sure to follow the correct procedure.